



Troubleshooting guide for MIS and MAC

Instructions for solving common issues







1 Important User Information



Warning

The MAC series of products are used to control electrical and mechanical components of motion control systems. You should test your motion system for safety under all potential conditions. Failure to do so can result in damage to equipment and/or serious injury to personnel.

Please contact your nearest JVL representative in case of technical assistance. Your nearest contact can be found on our web site www.jvl.dk

Copyright 1998-2024, JVL A/S. All rights reserved.

This user manual must not be reproduced in any form without prior written permission of JVL A/S. JVL A/S reserves the right to make changes to information contained in this manual without prior notice. Similarly, JVL A/S assumes no liability for printing errors or other omissions or discrepancies in this user manual.

MacTalk and MotoWare are registered trademarks

JVL A/S
Bregnerødvej 127
DK-3460 Birkerød
Denmark
Tlf. +45 45 82 44 40
Fax. +45 45 82 55 50
e-mail: jvl@jvl.dk

Internet: http://www.jvl.dk

2 Revisions

Ver.	Changes	Date	Init
1.0	Original document	2021-10-06	AW
1.1	Partially rewrote and updated document. New template used. 2024-10-30 JLN		JLN
1.2	Partially rewrote section 5. Minor changes to section 9.		







3 Contents

1	Important User Information					
2	Revisions					
3	Contents					
4						
5	Restoring/updating encoder firmware5					
6						
- (6.1 Power					
(6.2 Communication					
7	MIS: Encoder Com Error	7				
8	MIS: Encoder Lost Position	7				
9	MIS: Encoder Counting Error					
10	Closed Loop Error					
	Ethernet module not visible or "Internal error"					
	Low bus voltage					

Introduction

The following document is a guide to troubleshooting problems on MAC motor® Integrated Servo Motors and MIS ServoStep™ Integrated Stepper Motors. It contains step-by-step instructions to diagnosing and/or solving common issues one might encounter while using the motors.








4 Force updating firmware

Before performing this, please make sure that you are using serial communication. We recommend using our adapters: **RS485-USB-ATC-820**, **RS232-USB2.0-1** or **USB-RS232/485-OPTO**, as you might otherwise encounter issues.

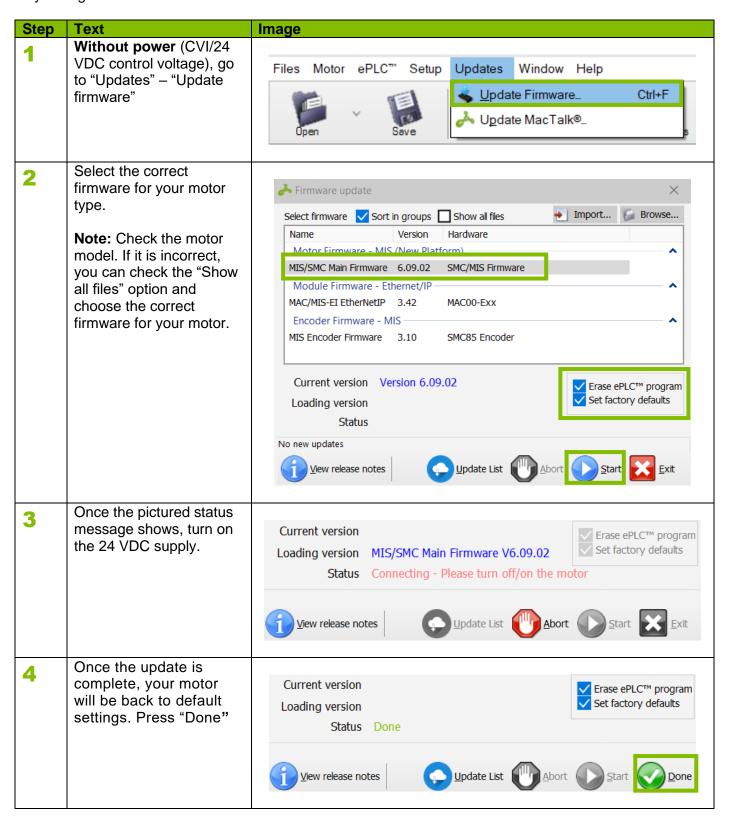







5 Restoring encoder firmware

In the case that the encoder loses its firmware, perform the following steps:

Step	Text	Image
1	Issue command 999 and then 345. To verify that the command has worked, there should be no negative values in the P1/P2 registers.	Advanced Scope ePLC™ EtherNet/IP Absolute Encoder Homing FastMac / Special command Special Command O 999 Advanced Scope ePLC™ EtherNet/IP Absolute Encoder Homing FastMac / Special command Special Command O 345
2	Update the encoder to the latest version.	Encoder Firmware - MIS MIS Encoder Firmware 3.10 SMC85 Encoder Current version (offline) Loading version Status No new updates Update List Abort Exit
3	The following message will appear. Read it and press "Next". The motor now updates the firmware, performing a factory reset of the motor in the process.	CAUTION THIS UPDATE REQUIRES AN ENCODER CALIBRATION, WHICH REQUIRES THE SHAFT TO BE FREE! ANY SETTINGS OR PROGRAM IN THE MOTOR WILL BE ERASED! Updating the encoder firmware will always require a new encoder calibration. In order to do the calibration, the motor will be set to default values. IMPORTANCE: To finish the calibration you need to close this dialog AFTER the firmware update is finished.
4	After the update is completed, the motor will restart and give you the following message. Press "Next" and wait a few minutes for the auto calibration to finish.	Note: Remove any mechanical attachments from the shaft. PLEASE REMOVE ANY MECHANICAL ATTACHMENTS FROM THE SHAFT! The motor is about to calibrate the encoder. Before proceeding, it is very important to remove any mechanical attachments from the shaft. The calibration will take APPROXIMATELY 150 SECONDS.







6 Common connection issues

6.1 Power

The motors require Control Voltage (24 VDC) to communicate. Please make sure this is connected to the correct pins and include proper grounding.

On a MAC motor: If there are LEDs on your module, please make sure these are illuminated. On a MIS motor: The LEDs should illuminate when power is attached, L3 should stay turned on.


6.2 Communication

Please make sure that you have a functioning USB-RS485 (MIS) or USB-RS232 (MAC) converter. Unfortunately, we have extensive experience where issues arise, such as firmware updates failing, due to the serial adapter.

We sell converters that we have personally certified as working for all communications tasks. The models that we can provide are RS485-USB-ATC-820, RS232-USB2.0-1

and USB-RS232/485-OPTO. Additionally, please make sure that you are using the correct communication cable; RSxxx-M12-1-5-xx.

Ensure that no other programs on the PC is trying to use the chosen COM port. Open MacTalk and choose the search radar icon in the top right corner [1]. Select the auto baud rate checkbox. If this does not work, click the cog icon [2], and select the widest address range [3]. Then click OK.

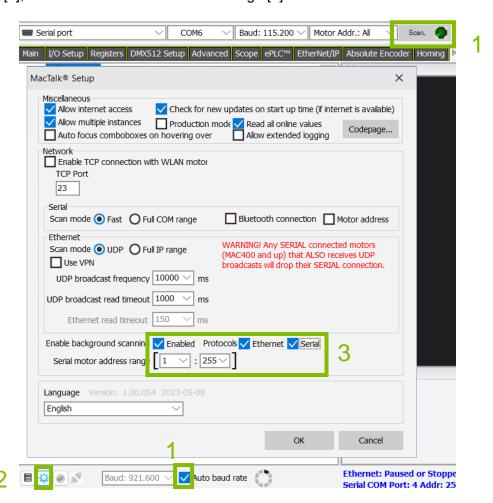

If the motor still does not connect, select every baud rate one by one in the "Baud: " dropdown menu next to the scan button. If this does not work, follow the instructions in section 4: Force updating firmware.







7 MIS: Encoder Com Error

Does the encoder firmware version read as "0.00"?

Yes: Update the H3/H4 encoder firmware.

No: Contact technical support.

To verify that the H3 calibration data is saved, issue command 355 and check register P1. If P1=1, OK

8 MIS: Encoder Lost Position

Click "Reset Position" and "Clear Errors"



If the error is cleared:

Use any active mode to make the motor move for a while. Verify that the error does not return. Disconnect the power and turn the shaft by hand for a couple of revolutions. Wait five minutes. Connect the power again. If the error is still gone, the motor should function normally again.

If the error is still present:

Update the encoder firmware and perform the automated calibration. Then, perform the steps from "If the error is cleared" above.

If the problem is still present, please contact JVL technical support.







9 MIS: Encoder Counting Error

Usually, this issue is caused by a hardware issue. It is normally unrecoverable. In the manual, it is known as "Encoder Reed Error":

Message no. / Message	9 / 'Encoder Reed error'
Type / Motor action	Unrecoverable error / Motor is set in Passive mode.
Error condition	 The absolute multi turn encoder (H3/H4) has detected a wrong sequence in the positioning algorithm. This error also occurs after firmware update.
Possible cause of this error	 This can be caused by a mechanical shock on the shaft or an external magnetic field. Because the encoder has been reset during a firmware update.
Solutions to avoid error	 Do not place the motor inside a strong magnetic field. Do not expose the shaft or the motor for mechanical shocks.
How to return to normal operation	 Reset the position (special command 354 in register 24), clear the error bit(s) in register 35 or cycle the power.
Error bit / Firmware name	Bit 9

In addition to the solutions outlined above:

- Check the grounding and ensure that all cables are properly shielded.
- Consider mounting a direct wire from the motor chassis to the machine it is used in.

Does the error occur at any time, or only when running at high speeds (over 500 RPM)?

At all times: Ensure that there is no mechanical stress put on the shaft; excess

pulling or pushing can cause the issue to occur.

Only at +500 RPM: The encoder needs to be serviced.

If none of the above helps solve the error, perform an encoder calibration as described in the <u>manual</u>. The section is called "Encoder calibration".

10 Closed Loop Error

Only valid for MIS/SMC

The H2 encoder needs to be calibrated, please follow the instructions in the link below: http://www.jvl.dk/files/me/mis_cl_error_quide.pdf

11 Ethernet module not visible or "Internal error"

In the case a there is an issue in updating the firmware, the communication between the ethernet module and the motor can become corrupted.

Update the module firmware.

If the correct module is not shown, press "Show all files" in the firmware update menu and select the proper firmware. If this does not work, force a firmware update by using the instructions in section *4: Force updating firmware.*







12 Low bus voltage

MIS/SMC

Is the correct bus voltage (same as supply) shown in "Bus Voltage (P+)" register 97?

Yes: Clear error register 35 and status register 36.

No: Are both CVI and P+ connected to the power source?

Yes: Replace unit or contact JVL technical support.
No: The unit needs both CVI and P+ to function

MAC with AC supply

Is the correct bus voltage ($V_{AC} \cdot \sqrt{2}$) shown in "Bus Voltage" register 198?

Yes: Clear error register 35 and status register 36.

No: Is the Main Power Connector, connected to the power source?

Yes: Replace unit or contact JVL technical support.

No: The motor needs AC supply to function.

MAC with DC supply

Is correct bus voltage (same as supply) shown in "Bus Voltage" register 198?

Yes: Clear error register 35 and status register 36.

No: Is the Main Power Connector, connected to the power source?

Yes: Replace unit or contact JVL technical support.

No: The motor needs DC supply at the Main Power Connector.

Old MiniMAC

Is correct supply voltage (same as supply) shown in "Supply Voltage" register 151?

Yes: Clear error register 35 and status register 36. No: Is the main connected to the power source?

Yes: Replace unit or contact JVL technical support.

No: The motor needs DC supply to function.

Applicable to all

Before replacing the unit or contacting JVL support, please make sure the external fuse is intact by unplugging the power cable and measuring the voltage from the connector.